




Failed Booster Seal Causes Master Cylinder Leaks

Application Vehicles equipped with power brake booster assemblies.

Problem Chronic master cylinder failure due to fluid leaking past secondary seal in the master cylinder bore.

Cause A defective master cylinder pushrod seal in the power brake booster allowing vacuum to draw fluid past secondary seal of the master cylinder.

Solution Replace both master cylinder and power brake unit.

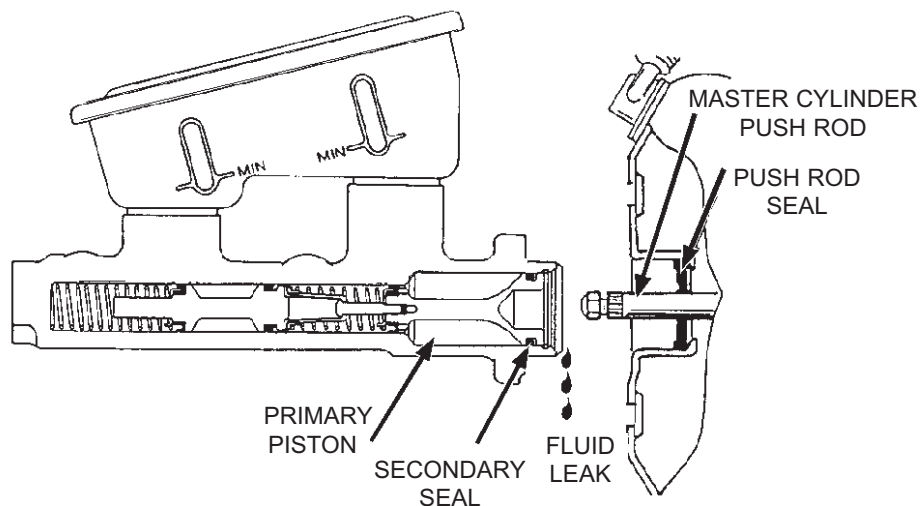

Note When replacing brake components, always flush entire brake system with approved brake fluid from a sealed container.